City of Boise

ADA Assessment

AppendixA-Library! At Cole & Ustick

01/27/2021

Report #TO21-B016

Prepared by:









Facility:

2523

Ustick Library

Location: Adult Audiobooks, New Books, and Fiction

Schedule: 2021

Estimated Cost: \$300.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §307.2

The desks protrude 14.75" into the circulation space at 35.5" above the floor.

RECOMMENDATIONS

Extend the sides of the desks down so the bottom edge is 27" maximum above the floor.

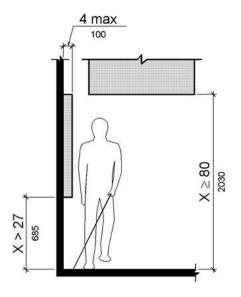









ID: Facility:

2414 Ustick Library

Location: Back Accessible Parking Space

Schedule: 2021

Estimated Cost: \$100.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §216.5

The parking sign identifying the accessible parking space does not meet the 60" minimum height from the ground at 54".

RECOMMENDATIONS

Remount the accessible parking signs to ensure 60" minimum height from the ground.





Facility:


2416

Ustick Library

Location: Back Accessible Parking Space

Schedule: 2021

Estimated Cost: \$1,000.00

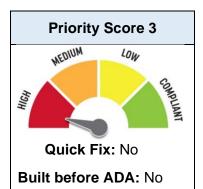

VIOLATIONS


2010 ADA Standards for Accessible Design Codes §406.4

There is no landing provided at the top of the curb ramp.

RECOMMENDATIONS

For the purposes of achieving greater accessibility and Human Centric Design, relocate the access aisle and curb ramp away from the dumpster.

Ensure that the curb has a maximum running slope of 8.3% and a maximum cross slope of 2%. Additionally, install a landing at the top of the curb ramp with a minimum clear length of 36".

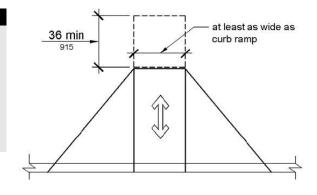











Facility:


2440

Ustick Library

Location: Back Door

Schedule: 2021

Estimated Cost: \$100.00

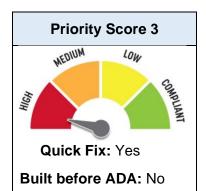

VIOLATIONS


2010 ADA Standards for Accessible Design Codes §216.2, §703

There is no tactile sign identifying the permanent room.

RECOMMENDATIONS

Install tactile signage on the latch side of the doorway at a height of 48" minimum to 60" maximum above the floor, identifying room by name or room number.

Signs shall be Braille with raised lettering and should be placed on the wall in the center of an 18"x18" clear floor space.

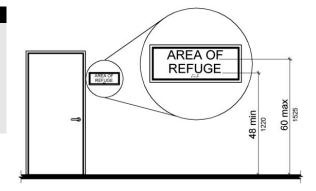





Facility:


2438

Ustick Library

Location: Back Fire Riser Room

Schedule: 2021

Estimated Cost: \$100.00

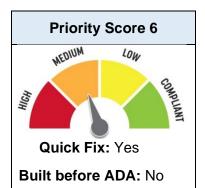


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile sign identifying the room is not in the correct location.

RECOMMENDATIONS

Reinstall the sign on the latch side of the door at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

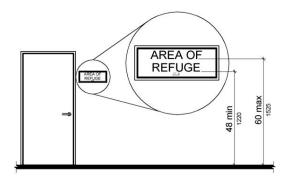





Facility:

2503

Ustick Library

Location: Bitterbrush Room

Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile sign identifying the room is not in the correct location.

RECOMMENDATIONS

Reinstall the sign on the latch side of the door at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

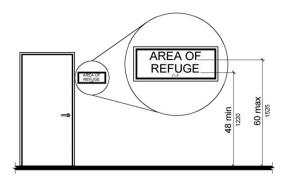






Facility:

2439 Ustick Library

Location: Book Returns

Schedule: 2021

Estimated Cost: \$500.00

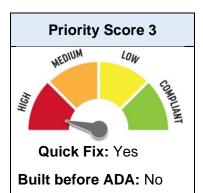

VIOLATIONS


2010 ADA Standards for Accessible Design Codes §302.1

There are tripping hazards in the accessible route.

RECOMMENDATIONS

Repave the area of the sidewalk to remove the cracks.



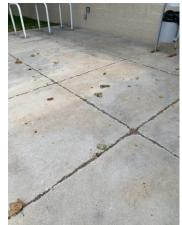





Facility:

2493

Ustick Library

Location: Children's Area

Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §216.4, §703

Doors serving as exits are not marked by tactile signage.

RECOMMENDATIONS

Place a tactile exit sign on the right side of the right hand door, that complies with §703.1, §703.2 and §703.5, identifying the exit doors. Install missing signage at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

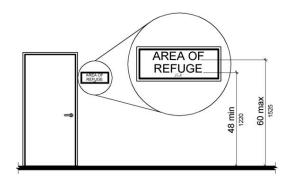





Facility:

2491

Ustick Library

Location: Children's Area

Schedule: 2022

Estimated Cost: \$1,000.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §306.3.3

There is no knee clearance underneath the counter.

RECOMMENDATIONS

Provide knee clearance underneath the counter at the sink that is a minimum of 11" deep at 9" above the floor and 8" deep at 27" above the floor.

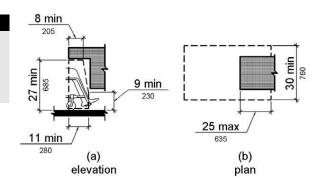





Facility:


2492

Ustick Library

Location: Children's Area

Schedule: 2023

Estimated Cost: \$2,000.00

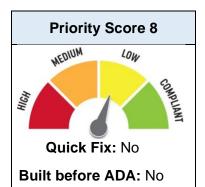

VIOLATIONS

2010 ADA Standards for Accessible Design Codes §902.3, §606.3

The sink is 34.25" above the floor.

The dining and work surface counter is 34.25" above the floor.

RECOMMENDATIONS

Lower the sink to the maximum height of 34" above the floor.

A 30" portion of the dining and work surface must be no higher than 34" above the floor.





Facility:

2442

Ustick Library

Location: Computer Lab Exterior Doors

Schedule: 2021

Estimated Cost: \$500.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §404.2.9

The opening and closing force of the doors is 13 pounds.

RECOMMENDATIONS

Adjust the resistance on the door so that it allows the doors to be continuously opened at a maximum force of 5 pounds.









Facility:

2441

Ustick Library

Location: Crosswalk

Schedule: 2022

Estimated Cost: \$1,000.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §303.2

There is a change in level greater than 0.25".

RECOMMENDATIONS

Resurface the pathway to reduce the change in level to less than 0.25" or 0.5" if beveled.







Facility:

2498

Ustick Library

Location: Electrical Room

Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile sign identifying the room is not in the correct location.

RECOMMENDATIONS

Reinstall the sign on the inactive leaf at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

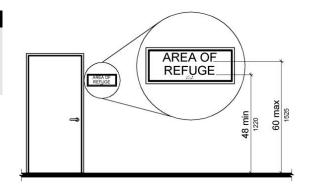





Facility:


2450

Ustick Library

Location: Electrical Room Exit

Schedule: 2021

Estimated Cost: \$100.00

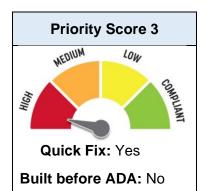

VIOLATIONS


2010 ADA Standards for Accessible Design Codes §216.4, §703

Doors serving as exits are not marked by tactile signage.

RECOMMENDATIONS

Place a tactile exit sign, that complies with §703.1, §703.2 and §703.5, identifying the exit doors.

Install missing signage at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

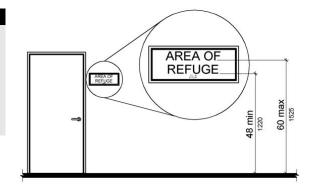





Facility:

2483

Ustick Library

Location: Family Restroom

Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile sign identifying the room is not in the correct location.

RECOMMENDATIONS

Reinstall the sign on the latch side of the door at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

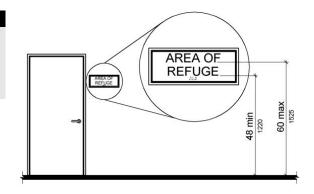









Facility:


2489

Ustick Library

Location: Family Restroom

Schedule: 2021

Estimated Cost: \$100.00

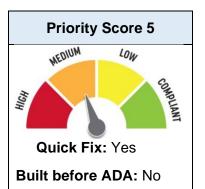

VIOLATIONS


2010 ADA Standards for Accessible Design Codes §604.7

The toilet paper dispenser is located out of the accessible reach range.

RECOMMENDATIONS

Remount the toilet paper dispenser to 7" minimum and 9" maximum in front of the water closet measured to the centerline of the dispenser.

The outlet of the dispenser shall be 15" minimum and 48" maximum above the floor and shall not be located behind.

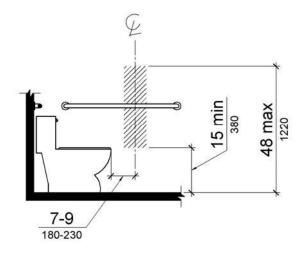









Facility:


2486

Ustick Library

Location: Family Restroom

Schedule: 2021

Estimated Cost: \$500.00

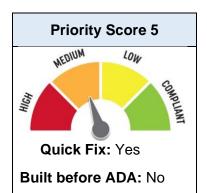


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.5.1

The side grab bar extends 53" from the rear wall.

RECOMMENDATIONS

Remount the side grab bar 12" maximum from the rear wall and extending 54" minimum from the rear wall.

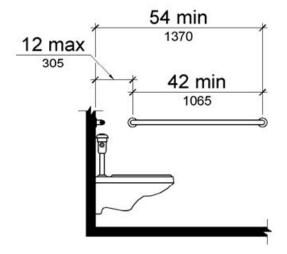









Facility:

2488

Ustick Library

Location: Family Restroom

Schedule: 2022

Estimated Cost: \$1,000.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.4

The toilet is 20" above the floor.

RECOMMENDATIONS

Lower the toilet seat to comply with the maximum height of 19" above the floor measured to the top of the seat.









Facility:


2451

Ustick Library

Location: Fire Riser Room

Schedule: 2021

Estimated Cost: \$100.00

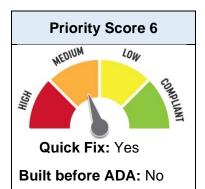


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile sign identifying the room is not in the correct location.

RECOMMENDATIONS

Reinstall the sign on the latch side of the door at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

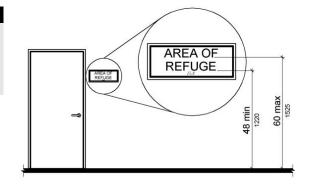






Facility:

2499 Ustick Library

Location: Kitchen Schedule: 2021

Estimated Cost: \$100.00

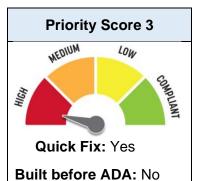

VIOLATIONS


2010 ADA Standards for Accessible Design Codes §216.2, §703

There is no tactile sign identifying the permanent room.

RECOMMENDATIONS

Install tactile signage on the latch side of the doorway at a height of 48" minimum to 60" maximum

above the floor, identifying room by name or room number. Signs shall be Braille with raised lettering and should be placed on the wall in the center of an 18"x18" clear floor space.

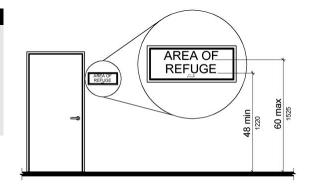





Facility:

2502

Ustick Library

Location: Kitchen Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile sign identifying the room is not in the correct location.

RECOMMENDATIONS

Reinstall the sign on the latch side of the door at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

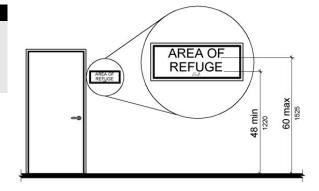





Facility:

2500

Ustick Library

Location: Kitchen Schedule: 2022

Estimated Cost: \$1,000.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §306.3.3

There is no knee clearance underneath the counter.

RECOMMENDATIONS

Provide knee clearance underneath the counter at the sink that is a minimum of 11" deep at 9" above the floor and 8" deep at 27" above the floor.

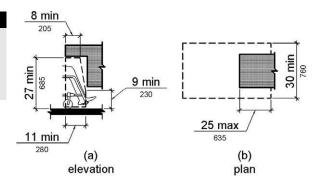







Facility:

Ustick Library

Location:

Schedule:

Estimated Cost:



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §902.3, §606.3

The sink is 34.25" above the floor.

The dining and work surface counter is 34.25" above the floor.

RECOMMENDATIONS

Lower the sink to the maximum height of 34" above the floor.

A 30" portion of the dining and work surface must be no higher than 34" above the floor.







Facility:


2458

Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$0.00

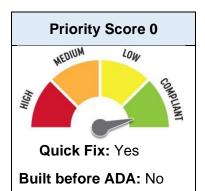

VIOLATIONS

2010 ADA Standards for Accessible Design Codes §607.6

The adjustable shower head is 64" above the floor.

RECOMMENDATIONS

For the purposes of achieving greater accessibility and Human Centric Design, consider installing a shorter vertical grab bar that ends at a maximum height of 48" above the floor.









Facility:

2471 Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$0.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §607.6

The adjustable shower head is 65" above the floor.

RECOMMENDATIONS

For the purposes of achieving greater accessibility and Human Centric Design, consider installing a shorter vertical grab bar that ends at a maximum height of 48" above the floor.











Facility:


2459

Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$100.00

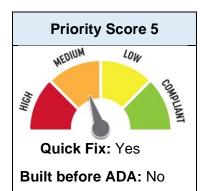


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §307.2

The shower curtain rod is 76" above the floor.

RECOMMENDATIONS

Raise the shower curtain rod to a minimum of 80" above the floor.

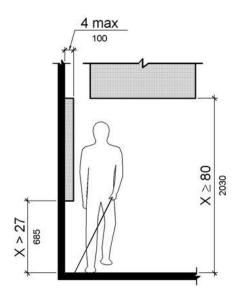









Facility:


2461

Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$100.00

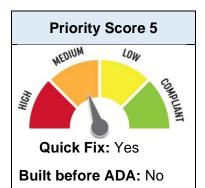

VIOLATIONS


2010 ADA Standards for Accessible Design Codes §604.7

The toilet paper dispenser is located out of the accessible reach range at 12" in front of the toilet.

RECOMMENDATIONS

Remount the toilet paper dispenser to 7" minimum and 9" maximum in front of the water closet measured to the centerline of the dispenser.

The outlet of the dispenser shall be 15" minimum and 48" maximum above the floor and shall not be located behind.

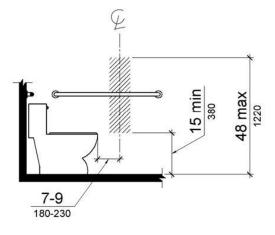







Facility:

2464

Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$100.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.8.1.2

The door to the accessible water closet is not self closing. Either self-closing hinges are not installed on the door or if installed, they are defective.

RECOMMENDATIONS

Install or reinstall self-closing hinges on the door to ensure that the door is self-closing per the ADA requirements.







ID: Facility:

2466 Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$100.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §603.3

The mirror is too high to be accessible at 41" above the floor.

RECOMMENDATIONS

Lower the mirror its bottom edge is a maximum height of 40" above the floor.





Facility:

2473 Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §307.2

The shower curtain rod is 76" above the floor.

RECOMMENDATIONS

Raise the shower curtain rod to a minimum of 80" above the floor.

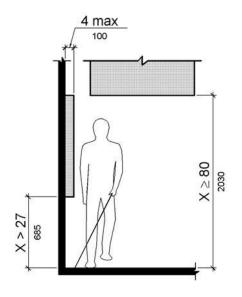











Facility:

2478

Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$100.00



VIOLATIONS


2010 ADA Standards for Accessible Design Codes §604.7

The toilet paper dispenser is located out of the accessible reach range.

RECOMMENDATIONS

Remount the toilet paper dispenser to 7" minimum and 9" maximum in front of the water closet measured to the centerline of the dispenser.

The outlet of the dispenser shall be 15" minimum and 48" maximum above the floor and shall not be located behind.

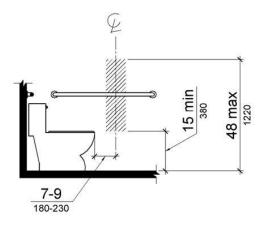







Facility:

2479

Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$100.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.8.1.2

The door to the accessible water closet is not self closing. Either self-closing hinges are not installed on the door or if installed, they are defective.

RECOMMENDATIONS

Install or reinstall self-closing hinges on the door to ensure that the door is self-closing per the ADA requirements.





ID: Facility:

2480 Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$100.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §603.3

The mirror is too high to be accessible at 41" above the floor.

RECOMMENDATIONS

Lower the mirror its bottom edge is a maximum height of 40" above the floor.





Facility:


2463

Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$500.00

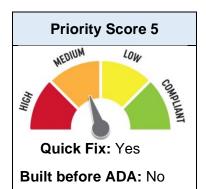


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.5.1

The side grab bar extends 53" from the rear wall.

RECOMMENDATIONS

Remount the side grab bar 12" maximum from the rear wall and extending 54" minimum from the rear wall.

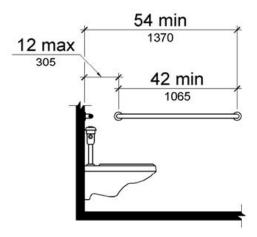







Facility:


2475

Ustick Library

Location: Library Staff Restroom

Schedule: 2021

Estimated Cost: \$500.00

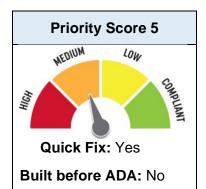


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.5.1

The side grab bar extends 53" from the rear wall.

RECOMMENDATIONS

Remount the side grab bar 12" maximum from the rear wall and extending 54" minimum from the rear wall.

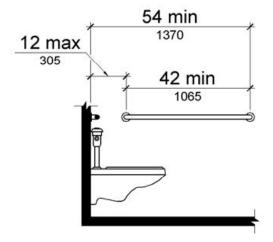







Facility:


2455

Ustick Library

Location: Library Staff Restroom

Schedule: 2022

Estimated Cost: \$1,000.00

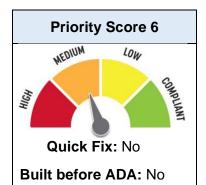


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §608.3, §609

The back wall grab bar is 5" from the control wall.

RECOMMENDATIONS

Install a grab bar across the back wall to a point 18" from the control wall at a maximum height of 36" above the bathroom floor.

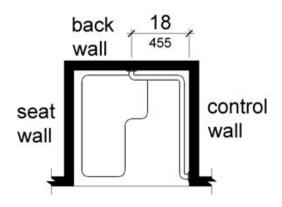







Facility:

2460

Ustick Library

Location: Library Staff Restroom

Schedule: 2022

Estimated Cost: \$1,000.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.4

The toilet is 19.5" above the floor.

RECOMMENDATIONS

Lower the toilet seat to comply with the maximum height of 19" above the floor measured to the top of the seat.







Facility:

2468

Ustick Library

Location: Library Staff Restroom

Schedule: 2022

Estimated Cost: \$1,000.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §608.3, §609

The back wall grab bar is 5" from the control wall.

RECOMMENDATIONS

Install a grab bar across the back wall to a point 18" from the control wall at a maximum height of 36" above the bathroom floor.

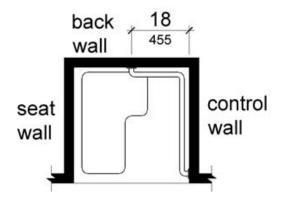











Facility:


2477

Ustick Library

Location: Library Staff Restroom

Schedule: 2022

Estimated Cost: \$1,000.00

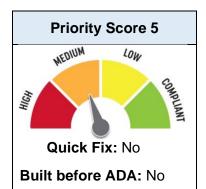

VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.4

The toilet is 20" above the floor.

RECOMMENDATIONS

Lower the toilet seat to comply with the maximum height of 19" above the floor measured to the top of the seat.







Facility:


2481

Ustick Library

Location: Library Staff Room 125

Schedule: 2021

Estimated Cost: \$100.00

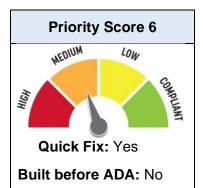


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile sign identifying the room is not in the correct location.

RECOMMENDATIONS

Reinstall the sign on the latch side of the door at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

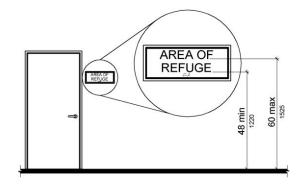





Facility:

2443 Ustick Library

Location: Lounge Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §308.2.2

The microwave outside of the obstructed forward reach range at 65" above the floor.

RECOMMENDATIONS

Lower the microwave by 17" to meet the accessible reach range of 48" maximum above the floor or install a secondary microwave.

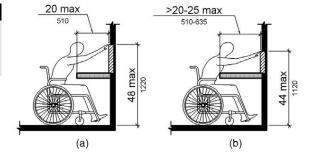





Facility:

2446

Ustick Library

Location: Lounge Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §308.2.1

The closet rod is outside of the unobstructed forward reach range at 61" above the floor.

RECOMMENDATIONS

Lower the closet rod by 13" to meet the accessible reach range of 48" maximum above the floor or install a secondary lower closet rod.

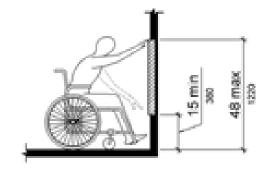






Facility:

2447

Ustick Library

Location: Lounge Schedule: 2021

Estimated Cost: \$100.00

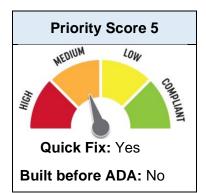


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §307.2

The biohazard container protrudes 5" into the circulation space at 29" above the floor.

RECOMMENDATIONS

Recess the biohazard container so it protrudes a maximum of 4", lower it so the bottom edge is 27" maximum above the floor, or place a cane detectable object beneath it.

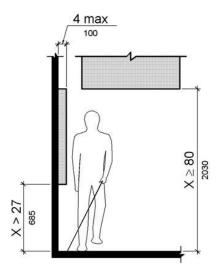






Facility:

2448

Ustick Library

Location: Lounge Schedule: 2021

Estimated Cost: \$100.00

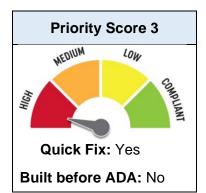

VIOLATIONS


2010 ADA Standards for Accessible Design Codes §216.4, §703

Doors serving as exits are not marked by tactile signage.

RECOMMENDATIONS

Place a tactile exit sign, that complies with §703.1, §703.2 and §703.5, identifying the exit doors.

Install missing signage at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

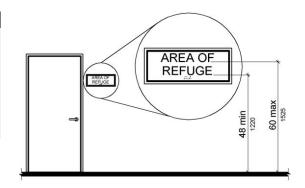





Facility:

2445

Ustick Library

Location: Lounge Schedule: 2022

Estimated Cost: \$1,000.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §306.3.3

There is no knee clearance underneath the counter.

RECOMMENDATIONS

Provide knee clearance underneath the counter at the sink that is a minimum of 11" deep at 9" above the floor and 8" deep at 27" above the floor.

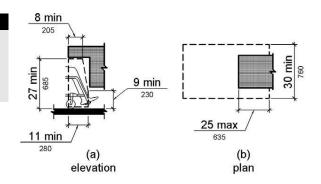





Facility:

2449

Ustick Library

Location: Lounge Schedule: 2022

Estimated Cost: \$1,000.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §211.2, §602.7

There is only one drinking fountain provided and the spout is 31" above the floor.

RECOMMENDATIONS

Install an additional drinking fountain at a minimum spout height of 38" and maximum of 43" above the floor.





Facility:


2520

Ustick Library

Location: Main Entrance

Schedule: 2022

Estimated Cost: \$1,000.00

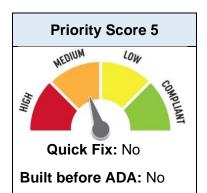


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §307.2

The cabinets protrude 11" into the circulation space at 27.5" above the floor.

RECOMMENDATIONS

Recess the cabinets so they protrude a maximum of 4", lower them so the bottom edge is 27" maximum above the floor, or place a cane detectable object beneath them.

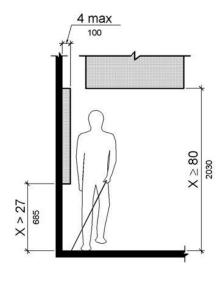









Facility:

2504

Ustick Library

Location: Main Entrance Men's Restroom

Schedule: 2021

Estimated Cost: \$100.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.8.1.2

The door to the accessible water closet is not self closing. Either self-closing hinges are not installed on the door or if installed, they are defective.

RECOMMENDATIONS

Install or reinstall self-closing hinges on the door to ensure that the door is self-closing per the ADA requirements.





Facility:

2509

Ustick Library

Location: Main Entrance Men's Restroom

Schedule: 2021

Estimated Cost: \$100.00



VIOLATIONS


2010 ADA Standards for Accessible Design Codes §604.7

The toilet paper dispenser is located out of the accessible reach range at 10" in front of the toilet.

RECOMMENDATIONS

Remount the toilet paper dispenser to 7" minimum and 9" maximum in front of the water closet measured to the centerline of the dispenser.

The outlet of the dispenser shall be 15" minimum and 48" maximum above the floor and shall not be located behind.

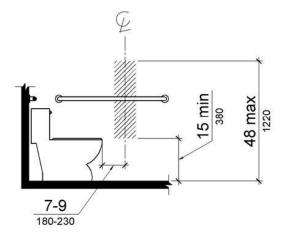







Facility:


2511

Ustick Library

Location: Main Entrance Men's Restroom

Schedule: 2021

Estimated Cost: \$100.00

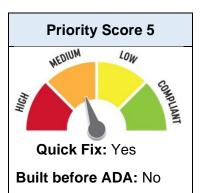


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §307.2

The sharps container protrudes 4.75" into the circulation space at 40" above the floor.

RECOMMENDATIONS

Recess the sharps container so it protrudes a maximum of 4", lower it so the bottom edge is 27" maximum above the floor, or place a cane detectable object beneath it.

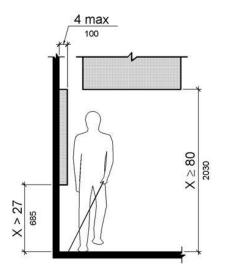





Facility:

2506

Ustick Library

Location: Main Entrance Men's Restroom

Schedule: 2021

Estimated Cost: \$500.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.5.1

The side grab bar extends 52.5" from the rear wall.

RECOMMENDATIONS

Remount the side grab bar 12" maximum from the rear wall and extending 54" minimum from the rear wall.

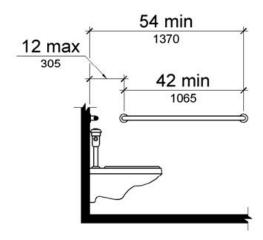










2510 Ustick Library

Facility:

Location: Main Entrance Men's Restroom

Schedule: 2022

Estimated Cost: \$1,000.00

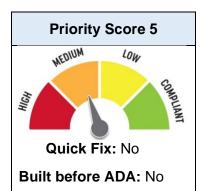

VIOLATIONS

2010 ADA Standards for Accessible Design Codes §605.2

The urinal is 17.75" above the floor.

RECOMMENDATIONS

Lower the urinal to a maximum height of 17" above the floor.





Facility:

2508

Ustick Library

Location: Main Entrance Men's Restroom

Schedule: 2021

Estimated Cost: \$1,000.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.4

The toilet is 19.5" above the floor.

RECOMMENDATIONS

Lower the toilet seat to comply with the maximum height of 19" above the floor measured to the top of the seat.







Facility:


2525

Ustick Library

Location: Main Entrance Parking

Schedule: 2021

Estimated Cost: \$2,000.00

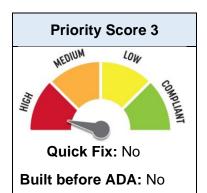

VIOLATIONS

2010 ADA Standards for Accessible Design Codes §502.2, §502.4


The access aisle has a 2.7% slope.

The accessible parking space is not of sufficient width at 90" wide.

RECOMMENDATIONS

Resurface the access aisle to reduce the slope to a maximum of 2% in all directions.

Restripe the van accessible parking spaces to a minimum of 132" wide and the car accessible parking spaces to a minimum of 96" wide.

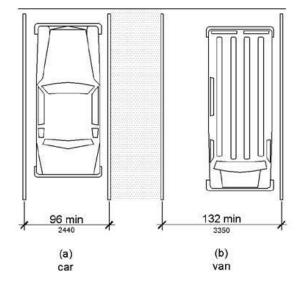












Facility:

2512 Ustick Library

Location: Main Entrance Women's Restroom

Schedule: 2021

Estimated Cost: \$100.00

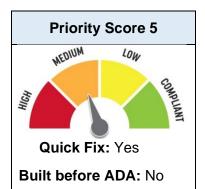

VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.8.1.2

The door to the accessible water closet is not self closing. Either self-closing hinges are not installed on the door or if installed, they are defective.

RECOMMENDATIONS

Install or reinstall self-closing hinges on the door to ensure that the door is self-closing per the ADA requirements.





Facility:


2517

Ustick Library

Location: Main Entrance Women's Restroom

Schedule: 2021

Estimated Cost: \$100.00

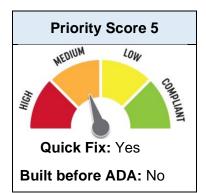


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §307.2

The sharps container protrudes 4.75" into the circulation space at 40" above the floor.

RECOMMENDATIONS

Recess the sharps container so it protrudes a maximum of 4", lower it so the bottom edge is 27" maximum above the floor, or place a cane detectable object beneath it.

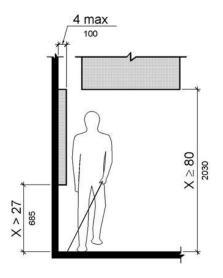







Facility:


2518

Ustick Library

Location: Main Entrance Women's Restroom

Schedule: 2021

Estimated Cost: \$100.00

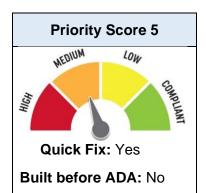


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §307.2

The dispenser protrudes 6.5" into the circulation space at 34" above the floor.

RECOMMENDATIONS

Recess the dispenser so it protrudes a maximum of 4", lower it so the bottom edge is 27" maximum above the floor, or place a cane detectable object beneath it.

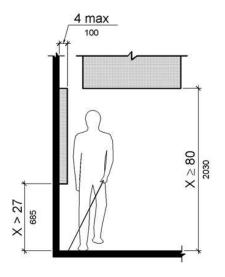







Facility:


2514

Ustick Library

Location: Main Entrance Women's Restroom

Schedule: 2021

Estimated Cost: \$100.00

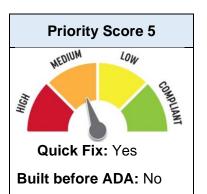


VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.5.1

The side grab bar extends 52" from the rear wall.

RECOMMENDATIONS

Remount the side grab bar 11" from the rear wall.

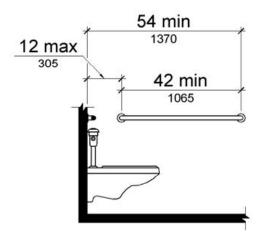









Facility:


2516

Ustick Library

Location: Main Entrance Women's Restroom

Schedule: 2021

Estimated Cost: \$1,000.00

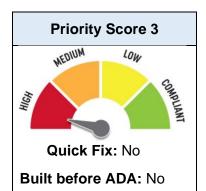

VIOLATIONS

2010 ADA Standards for Accessible Design Codes §604.4

The toilet is 19.5" above the floor.

RECOMMENDATIONS

Lower the toilet seat to comply with the maximum height of 19" above the floor measured to the top of the seat.







Facility:

2496

Ustick Library

Location: Multipurpose Room

Schedule: 2021

Estimated Cost: \$100.00



VIOLATIONS


2010 ADA Standards for Accessible Design Codes §216.4, §703

Doors serving as exits are not marked by tactile signage

RECOMMENDATIONS

Place a tactile exit sign, that complies with §703.1, §703.2 and §703.5, identifying the exit doors.

Install missing signage at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

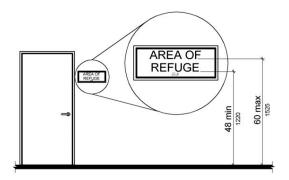





Facility:

2497

Ustick Library

Location: Multipurpose Room

Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile sign identifying the room is not in the correct location.

RECOMMENDATIONS

Reinstall the sign on the inactive leaf of the door at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

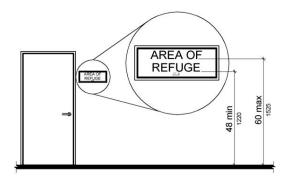







Facility:

2495

Ustick Library

Location: Multipurpose Room

Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile signs identifying the exits are not in the correct location.

RECOMMENDATIONS

Reinstall the signs to the right side of the right hand doors at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

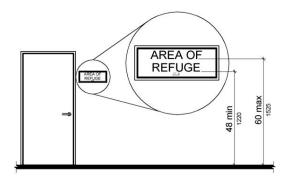









Facility:

2494

Ustick Library

Location: Multipurpose Room

Schedule: 2023

Estimated Cost: \$3,000.00



VIOLATIONS

2010 ADA Standards for Accessible Design Codes §707

The interactive touch screen does not have any sound or tactile components. Therefore, a visually impaired person would not be able to access the information provided by the kiosk

RECOMMENDATIONS

Audio instructions must be provided that guide the user through all the functions of the machine. Tactile instructions must be provided informing the user on the method of activating the audio instructions.

Controls to operate the kiosk must meet the requirements of §707.





Facility:

2490

Ustick Library

Location: Sagebrush Room

Schedule: 2021

Estimated Cost: \$100




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §703.4

The tactile sign identifying the room is not in the correct location.

RECOMMENDATIONS

Reinstall the sign on the latch side of the door at 48" minimum above the floor measured from the baseline of the lowest character and 60" maximum measured from the baseline of the highest character.

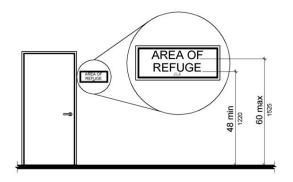





Facility:

2522

Ustick Library

Location: Shelves (Top Only)

Schedule: 2021

Estimated Cost: \$100.00




VIOLATIONS

2010 ADA Standards for Accessible Design Codes §308.2.1

The top shelves are outside of the unobstructed forward reach range at 58" above the floor.

RECOMMENDATIONS

Ensure that the library has a policy that states that employees and volunteers shall provide assistance to patrons in retrieving items from the shelves that are located beyond 48" above the floor.

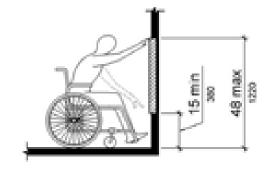











Facility:


2482

Ustick Library

Location: Study Room 105

Schedule: 2021

Estimated Cost: \$100.00

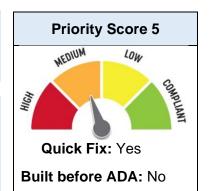

VIOLATIONS

2010 ADA Standards for Accessible Design Codes §307.2

The TV protrudes 7" into the circulation space at 46.5" above the floor.

RECOMMENDATIONS

Recess the TV so it protrudes a maximum of 4", raise it so the bottom edge is 80" maximum above the floor, or place a cane detectable object beneath it.

